

UNCONTROLLED DOCUMENT

PART NUMBER

LCD-H2401M20TR-D

REV.

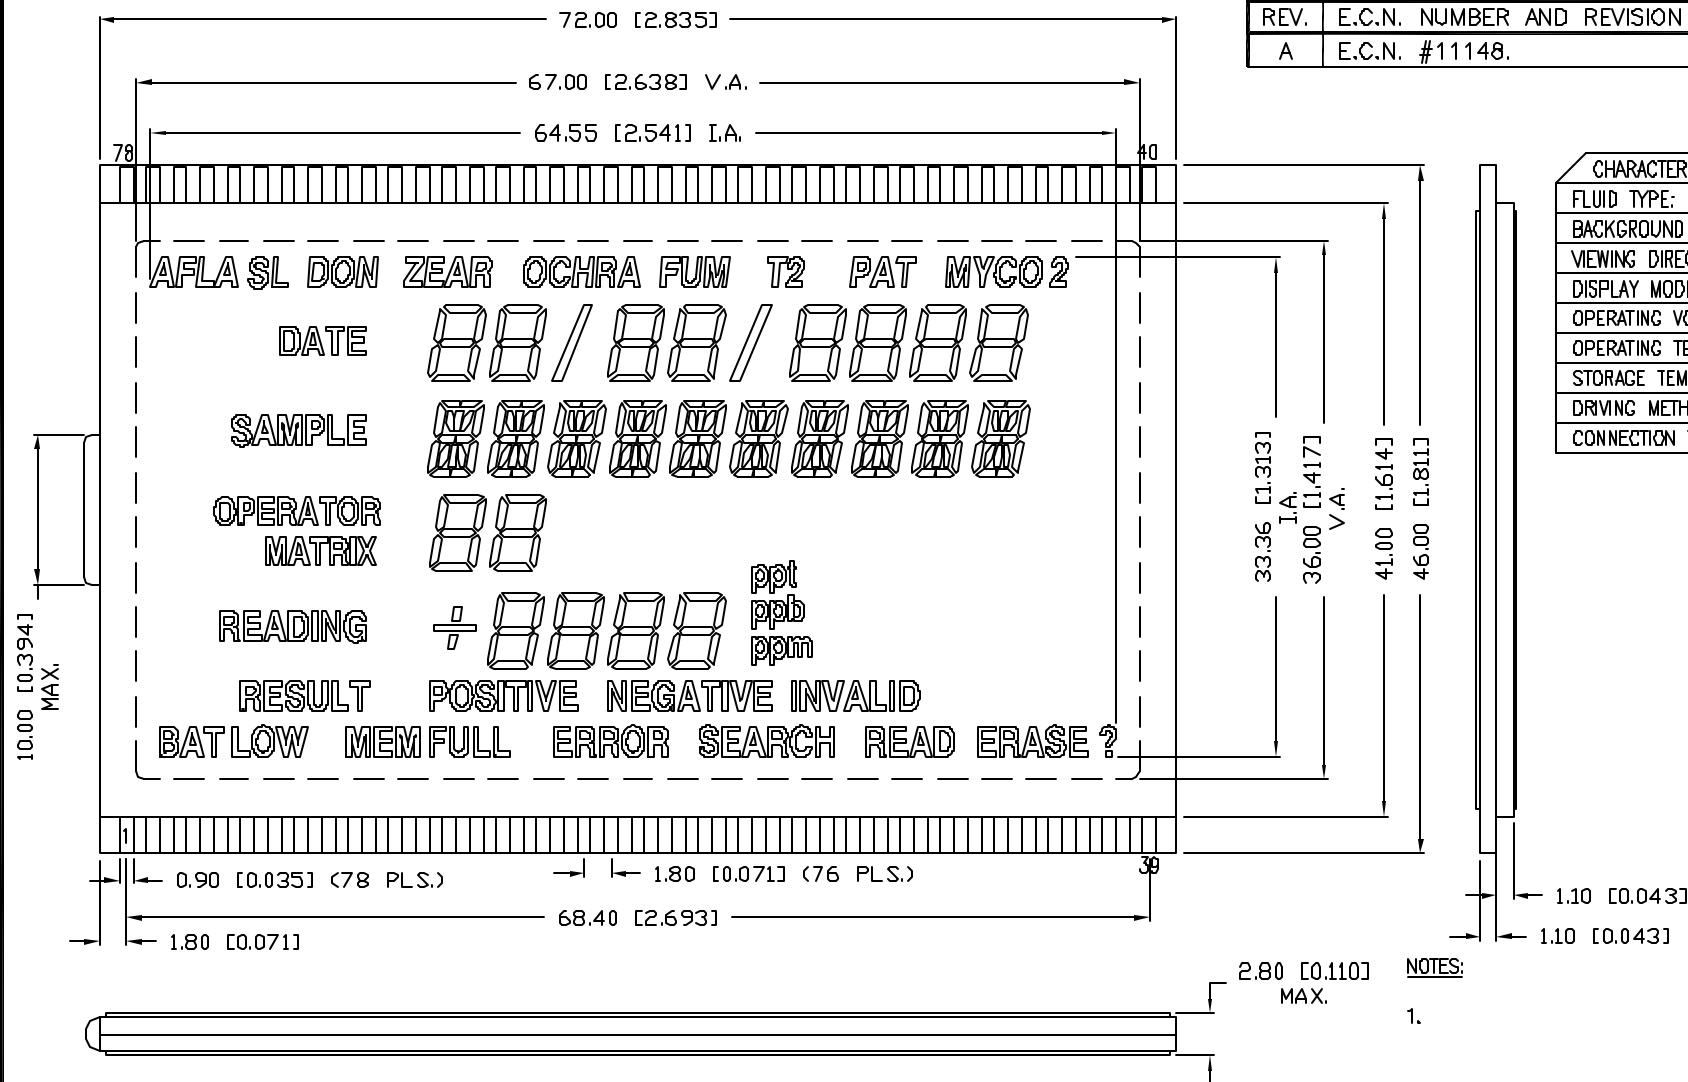
P2

REV. E.C.N. NUMBER AND REVISION COMMENTS

DATE

A E.C.N. #11148.

02.06.07



CHARACTERISTICS	
FLUID TYPE:	TN
BACKGROUND COLOR:	GRAY
VIEWING DIRECTION:	6:00
DISPLAY MODE:	REFLECTIVE
OPERATING VOLTAGE:	5.0 VOLTS
OPERATING TEMP.	-30°C TO +75°C
STORAGE TEMP.	-40°C TO +80°C
DRIVING METHOD:	1/4 DUTY, 1/3 BIAS
CONNECTION TYPE:	ELASTOMER

2.80 [0.110] MAX.

1.

NOTES:

A



UNCONTROLLED DOCUMENT

*UNLESS OTHERWISE SPECIFIED TOLERANCES PER DECIMAL PRECISION ARE: X=±1 (±0.039), X.X=±0.5 (±0.020), X.XX=±0.25 (±0.010), X.XXX=±0.127 (±0.005). LEAD SIZE=±0.05 (±0.002), LEAD LENGTH=±0.75 (±0.030). MIN.=+0.00 DECIMAL PRECISION MAX.=+0.00 DECIMAL PRECISION

REV.

PART NUMBER

P2

LCD-H2401M20TR-D

CONFIDENTIAL INFORMATION
THE INFORMATION CONTAINED IN THIS DOCUMENT IS THE PROPERTY OF LUMEX INC. EXCEPT AS SPECIFICALLY AUTHORIZED IN WRITING BY LUMEX INC., THE HOLDER OF THIS DOCUMENT SHALL KEEP ALL INFORMATION CONTAINED HEREIN CONFIDENTIAL AND SHALL PROTECT SAME IN WHOLE OR IN PART FROM DISCLOSURE AND DISSEMINATION TO ALL THIRD PARTIES.



290 E. HELEN ROAD
PALATINE, IL 60067-6976
PHONE: +1.847.359.2790
US WEB: www.lumex.com
TW WEB: www.lumex.com.tw

CUSTOM LCD PANEL, TN, REFLECTIVE,
HIGH OPERATING TEMP, NO PINS.

RELIABILITY NOTE
OUR MANY YEARS OF EXPERIENCE DATA ACCUMULATION INDICATE THAT SOLDER HEAT IS A MAJOR CAUSE OF EARLY AND FUTURE FAILURE. PLEASE PAY ATTENTION TO YOUR SOLDERING PROCESS.

DRAWN BY:

JC

CHECKED BY:

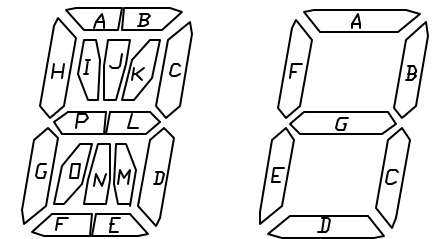
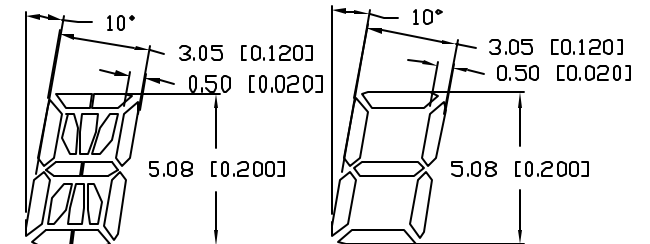
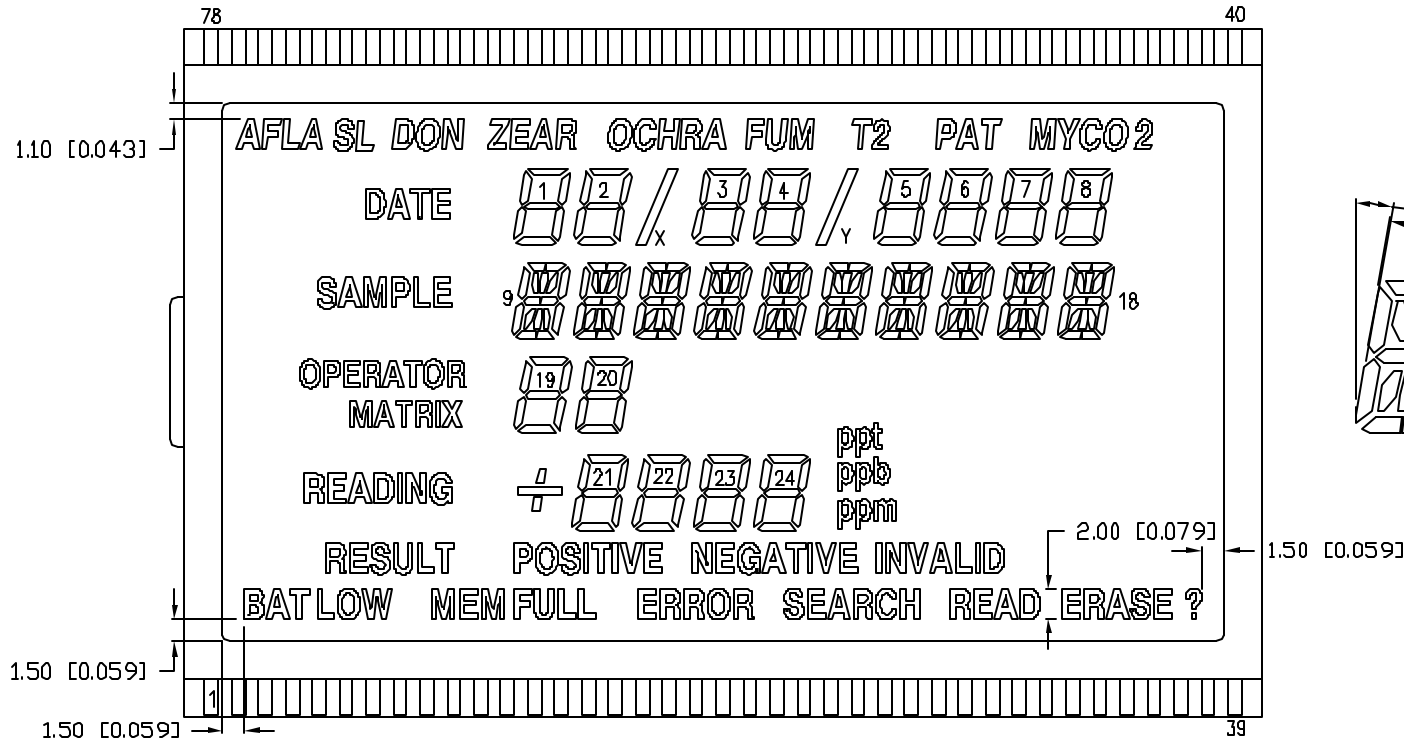
APPROVED BY:

DATE: 7.15.05

PAGE: 1 OF 1

SCALE: N/A

UNCONTROLLED DOCUMENT

PART NUMBER
LCD-H2401M20TR-DREV.
P2REV. E.C.N. NUMBER AND REVISION COMMENTS
A SEE PAGE #1DATE
???

UNCONTROLLED DOCUMENT

*UNLESS OTHERWISE SPECIFIED TOLERANCES PER DECIMAL PRECISION ARE: X=±1 (±0.039), XX=±0.5 (±0.020), XXX=±0.25 (±0.010), XXXX=±0.127 (±0.005). LEAD SIZE=±0.05 (±0.002), LEAD LENGTH=±0.75 (±0.030). MIN.= +DECIMAL PRECISION -0.00 MAX.= +0.00 -DECIMAL PRECISION

REV.
P2PART NUMBER
LCD-H2401M20TR-DCUSTOM LCD PANEL, TN, REFLECTIVE,
HIGH OPERATING TEMP, NO PINS.

CONFIDENTIAL INFORMATION

THE INFORMATION CONTAINED IN THIS DOCUMENT IS THE PROPERTY OF LUMEX INC. EXCEPT AS SPECIFICALLY AUTHORIZED IN WRITING BY LUMEX INC., THE HOLDER OF THIS DOCUMENT SHALL KEEP ALL INFORMATION CONTAINED HEREIN CONFIDENTIAL AND SHALL PROTECT SAME IN WHOLE OR IN PART FROM DISCLOSURE AND DISSEMINATION TO ALL THIRD PARTIES.

RELIABILITY NOTE

OUR MANY YEARS OF EXPERIENCE DATA ACCUMULATION INDICATE THAT SOLDER HEAT IS A MAJOR CAUSE OF EARLY AND FUTURE FAILURE. PLEASE PAY ATTENTION TO YOUR SOLDERING PROCESS.



290 E. HELEN ROAD
PALATINE, IL 60067-6976
PHONE: +1.847.359.2790
US WEB: www.lumex.com
TW WEB: www.lumex.com.tw

DRAWN BY:
JC

CHECKED BY:

APPROVED BY:

DATE: 7.15.05
PAGE: 1 OF 1
SCALE: N/A

UNCONTROLLED DOCUMENT

PART NUMBER

LCD-H2401M20TR-D

REV.

P2

REV. E.C.N. NUMBER AND REVISION COMMENTS

DATE

A

SEE PAGE #1

PIN	1	2	3	4	5	6	7	8	9	10	11	12	13	14	15	16	17	18	19	20
COM1	9N	9M	10N	10M	19A	19B	20A	20B	—	(NEG)	21A	21B	22A	22B	23A	23B	24A	24B	?	—
COM2	9L	9D	10L	10D	19F	19G	20F	20G	MATRIX	RESULT	21F	21G	22F	22G	23F	23G	24F	24G	ERASE	—
COM3	9K	9C	10K	10C	19E	19C	20E	20C	MEM	PLUS	21E	21C	22E	22C	23E	23C	24E	24C	INVALID	—
COM4	9F	9E	10F	10E	OPERATOR	19D	READING	20D	BAT LOW	FULL	POSITIVE	21D	ERROR	22D	NEGATIVE	23D	SEARCH	24D	READ	COM4
PIN	21	22	23	24	25	26	27	28	29	30	31	32	33	34	35	36	37	38	39	40
COM1	—	—	COM1	11N	11M	12N	12M	13N	13M	14N	14M	15N	15M	16N	16M	17N	17M	18N	18M	18□
COM2	—	COM2	—	11L	11D	12L	12D	13L	13D	14L	14D	15L	15D	16L	16D	17L	17D	18L	18D	18P
COM3	COM3	—	—	11K	11C	12K	12C	13K	13C	14K	14C	15K	15C	16K	16C	17K	17C	18K	18C	18J
COM4	—	—	—	11F	11E	12F	12E	13F	13E	14F	14E	15F	15E	16F	16E	17F	17E	18F	18E	18B
PIN	41	42	43	44	45	46	47	48	49	50	51	52	53	54	55	56	57	58	59	60
COM1	18G	17□	17G	8B	8A	7B	7A	6B	6A	5B	5A	16□	16G	—	15□	15G	14□	14G	4B	4A
COM2	18H	17P	17H	8G	8F	7G	7F	6G	6F	5G	5F	16P	16H	—	15P	15H	14P	14H	4G	4F
COM3	18I	17J	17I	8C	8E	7C	7E	6C	6E	5C	5E	16J	16I	—	15J	15I	14J	14I	4C	4E
COM4	18A	17B	17A	8D	2	7D	AFLA	6D	MYCO	5D	PAT	16B	16A	/(Y)	15B	15A	14B	14A	4D	T2
PIN	61	62	63	64	65	66	67	68	69	70	71	72	73	74	75	76	77	78		
COM1	3B	3A	13□	13G	ppt	12□	12G	11□	11G	2B	2A	1B	1A	10□	10G	9□	9G	SAMPLE		
COM2	3G	3F	13P	13H	ppb	12P	12H	11P	11H	2G	2F	1G	1F	10P	10H	9P	9H	DATE		
COM3	3C	3E	13J	13I	ppm	12J	12I	11J	11I	2C	2E	1C	1E	10J	10I	9J	9I	DOX		
COM4	3D	FUM	13B	13A	/(X)	12B	12A	11B	11A	2D	UCHRA	1D	ZEAR	10B	10A	9B	9A	SL		

UNCONTROLLED DOCUMENT

*UNLESS OTHERWISE SPECIFIED TOLERANCES PER DECIMAL PRECISION ARE: X=±1 (±0.039), XX=±0.5 (±0.020), XXX=±0.25 (±0.010), XXXX=±0.127 (±0.005). LEAD SIZE=±0.05 (±0.002), LEAD LENGTH=±0.75 (±0.030), MIN= +DECIMAL PRECISION -0.00 MAX.= +0.00 -DECIMAL PRECISION

REV.

P2

PART NUMBER

LCD-H2401M20TR-D

CUSTOM LCD PANEL, TN, REFLECTIVE,
HIGH OPERATING TEMP, NO PINS.

CONFIDENTIAL INFORMATION

THE INFORMATION CONTAINED IN THIS DOCUMENT IS THE PROPERTY OF LUMEX INC. EXCEPT AS SPECIFICALLY AUTHORIZED IN WRITING BY LUMEX INC., THE HOLDER OF THIS DOCUMENT SHALL KEEP ALL INFORMATION CONTAINED HEREIN CONFIDENTIAL AND SHALL PROTECT SAME IN WHOLE OR IN PART FROM DISCLOSURE AND DISSEMINATION TO ALL THIRD PARTIES.

RELIABILITY NOTE

OUR MANY YEARS OF EXPERIENCE DATA ACCUMULATION INDICATE THAT SOLDER HEAT IS A MAJOR CAUSE OF EARLY AND FUTURE FAILURE. PLEASE PAY ATTENTION TO YOUR SOLDERING PROCESS.

290 E. HELEN ROAD
PALATINE, IL 60067-6976
PHONE: +1.847.359.2790
US WEB: www.lumex.com
TW WEB: www.lumex.com.tw

DRAWN BY:

JD

CHECKED BY:

APPROVED BY:

DATE: 7.15.05

PAGE: 1 OF 1

SCALE: N/A