
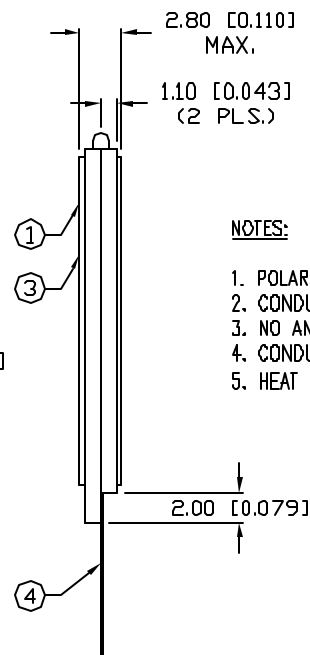


UNCONTROLLED DOCUMENT


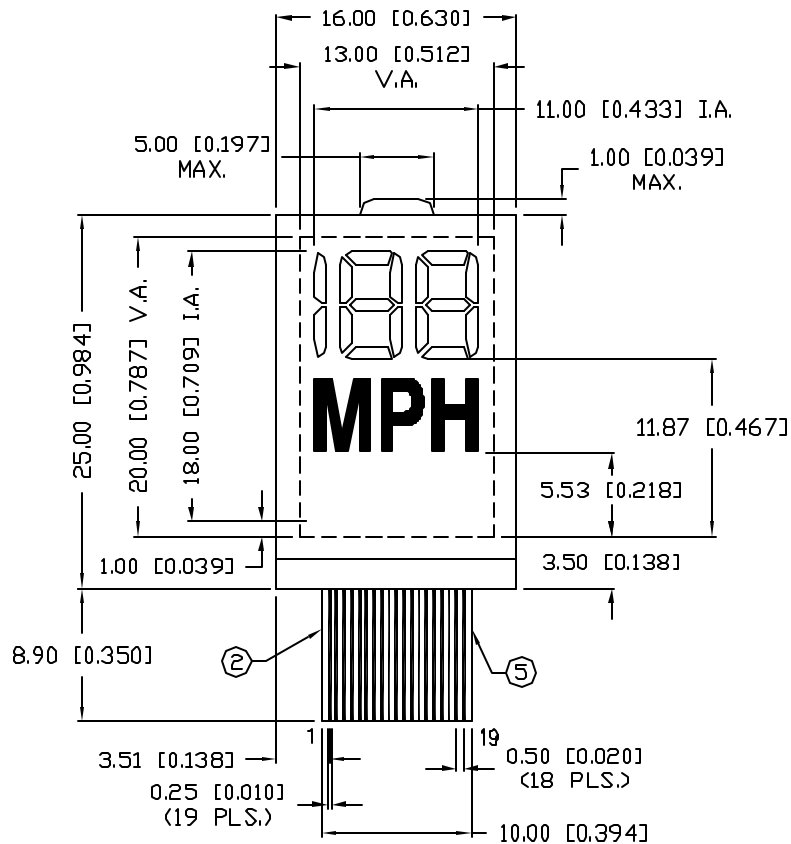


NOTES:

1. POLARIZER TYPE: SHC
2. CONDUCTOR PAD COUNT TO BE EXACTLY 19.
3. NO ANIT-GLARE ON FRONT POLARIZER.
4. CONDUCTOR CONTACT SIDE.
5. HEAT SEAL: 7705400-400DP(JC-DP TYPE).

PINOUT TABLE

SEGMENT	PIN
COM	1
1BC	2
2G	3
2E	4
2D	5
2C	6
3G	7
3E	8
3D	9
3C	10
M	11
P	12
H	13
3B	14
3A	15
3F	16
2B	17
2A	18
2F	19

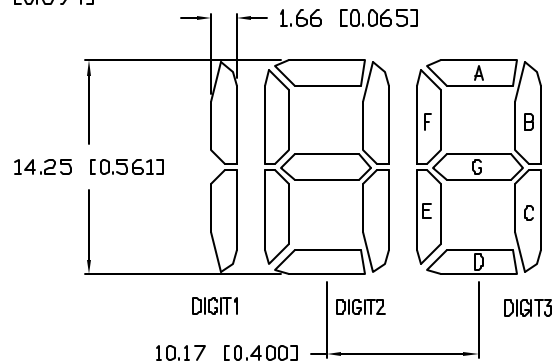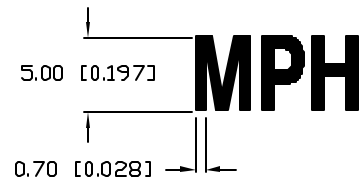

CHARACTERISTICS	
FLUID TYPE	TN
BACKGROUND COLOR	BLACK MASK
VIEWING DIRECTION	12:00
DISPLAY MODE	TRANSMISSIVE
OPERATING VOLTAGE	5.0V A.C.
OPERATING TEMP.	-30°C TO 85°C
STORAGE TEMP.	-40°C TO 85°C
DRIVING METHOD	STATIC
CONNECTION TYPE	19 PAD HEAT SEAL CABLE

*UNLESS OTHERWISE SPECIFIED TOLERANCES PER DECIMAL PRECISION ARE: X=±1 (±0.039), X.X=±0.5 (±0.020), X.XX=±0.25 (±0.010), X.XXX=±0.127 (±0.005). LEAD SIZE=±0.05 (±0.002), LEAD LENGTH=±0.75 (±0.030), MIN.=+0.00/-0.00 DECIMAL PRECISION MAX.=+0.00/-0.00 DECIMAL PRECISION

REV.

A

PART NUMBER

LCD-UH2X2M30TB-1S

CUSTOM LCD GLASS.

CONFIDENTIAL INFORMATION

THE INFORMATION CONTAINED IN THIS DOCUMENT IS THE PROPERTY OF LUMEX INC. EXCEPT AS SPECIFICALLY AUTHORIZED IN WRITING BY LUMEX INC., THE HOLDER OF THIS DOCUMENT SHALL KEEP ALL INFORMATION CONTAINED HEREIN CONFIDENTIAL AND SHALL PROTECT SAME IN WHOLE OR IN PART FROM DISCLOSURE AND DISSEMINATION TO ALL THIRD PARTIES.

RELIABILITY NOTE

OUR MANY YEARS OF EXPERIENCE DATA ACCUMULATION INDICATE THAT SOLDER HEAT IS A MAJOR CAUSE OF EARLY AND FUTURE FAILURE. PLEASE PAY ATTENTION TO YOUR SOLDERING PROCESS.



290 E. HELEN ROAD
PALATINE, IL 60067-6976
PHONE: +1.847.359.2790
US WEB: www.lumex.com
TW WEB: www.lumex.com.tw

DRAWN BY:

JC

CHECKED BY:

APPROVED BY:

DATE: 10.17.02

PAGE: 1 OF 1

SCALE: N/A

UNCONTROLLED DOCUMENT