
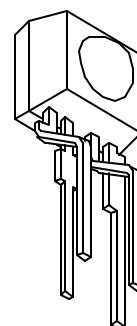
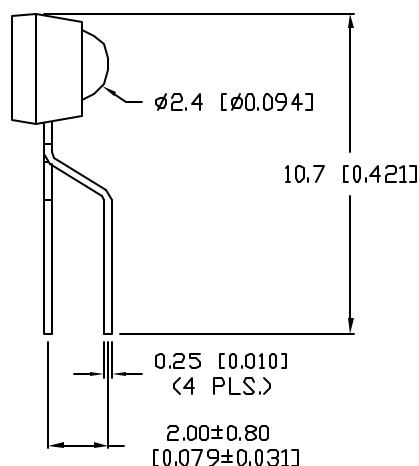
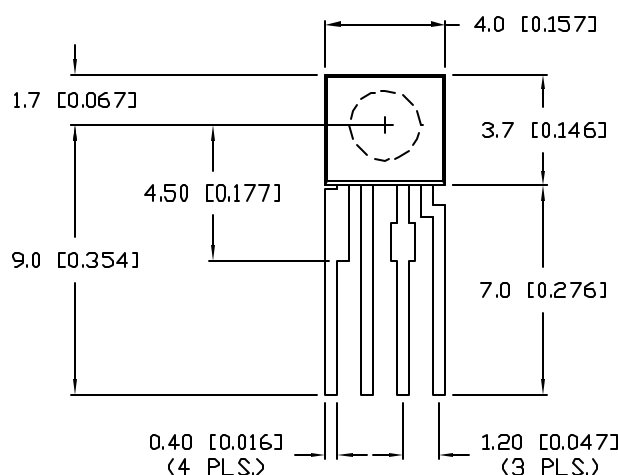



UNCONTROLLED DOCUMENT

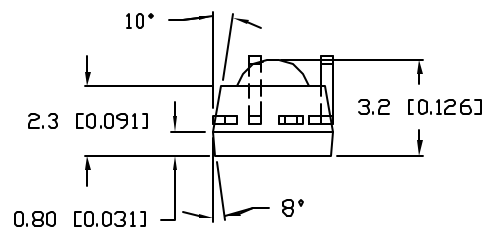

PIN OUT:

1. OUT-B.
2. GND.
3. VCC.
4. OUT-A.

TIMING CHART:



PART NUMBER		REV.
OED-LDR2444H-45		A
REV.	E.C.N. NUMBER AND REVISION COMMENTS	DATE
A	E.C.N. #10880.	6.24.02

ELECTRO-OPTICAL CHARACTERISTICS $T_A=25^{\circ}\text{C}$, $R_s=100\text{K}\Omega$

PARAMETER	SYMBOL	TEST CONDITION	MIN.	TYP.	MAX.	UNITS
SUPPLY VOLTAGE	V_{CC}		3.5	5.0	5.5	V
SUPPLY CURRENT	I_{DC}	$V_{CC}=5.5\text{V}$ (all output low) PHOTO DETECTOR DARK		0.1	3.0	μA
INPUT LEAKAGE	I_{IN}	$V_{CC}=5.0\text{V}$ $V_{IN}=5.0\text{V}$ (for $T_1 \sim T_4$)			750	μA
OUTPUT CURRENT	I_{OH} I_{OL}	$V_{CC}=5.0\text{V}$, $V_{OH}=4.5\text{V}$ $V_{CC}=5.0\text{V}$, $V_{OL}=0.5\text{V}$			-450	μA mA
PULSE DURATION	T_{ON}		2.5		15	μS
PULSE DURATION	T_{OFF}		15			μS
EPOXY LENS FINISH: BLACK RESIN EPOXY						

LIMITS OF SAFE OPERATION AT 25°C

PARAMETER	SYMBOL	RATING	UNITS
SUPPLY VOLTAGE	V_{CC}	-0.2~7.0	V
OTHER VOLTAGE		-0.3~ $V_{CC}+0.3$	V
OPERATING TEMP.	T_{OPR}	-40 TO +75	$^{\circ}\text{C}$
STORAGE TEMP.	T_{STR}	-40 TO +80	$^{\circ}\text{C}$
SOLDERING TEMP.		+260	$^{\circ}\text{C}$
2.0mm FROM BODY			3 SEC. MAX

NOTES:

1. CHIPS ARE MOUNTED HORIZONTALLY.

UNCONTROLLED DOCUMENT

*UNLESS OTHERWISE SPECIFIED TOLERANCES PER DECIMAL PRECISION ARE: X=±1 (±0.039), XX=±0.5 (±0.020), XXX=±0.25 (±0.010), XXXX=±0.127 (±0.005). LEAD SIZE=±0.05 (±0.002), LEAD LENGTH=±0.75 (±0.030), MIN.=+DECIMAL PRECISION -0.00, MAX.=+0.00 -DECIMAL PRECISION

REV.	PART NUMBER
A	OED-LDR2444H-45

2.4mm DOMED RIGHT ANGLE DETECTOR,
4 LEADED, BLACK RESIN EPOXY, HORIZONTAL CHIPS.

CONFIDENTIAL INFORMATION
THE INFORMATION CONTAINED IN THIS DOCUMENT IS THE PROPERTY OF LUMEX INC. EXCEPT AS SPECIFICALLY AUTHORIZED IN WRITING BY LUMEX INC., THE HOLDER OF THIS DOCUMENT SHALL KEEP ALL INFORMATION CONTAINED HEREIN CONFIDENTIAL AND SHALL PROTECT SAME IN WHOLE OR IN PART FROM DISCLOSURE AND DISSEMINATION TO ALL THIRD PARTIES.

RELIABILITY NOTE
OUR MANY YEARS OF EXPERIENCE DATA ACCUMULATION INDICATE THAT SOLDER HEAT IS A MAJOR CAUSE OF EARLY AND FUTURE FAILURE. PLEASE PAY ATTENTION TO YOUR SOLDERING PROCESS.



290 E. HELEN ROAD
PALATINE, IL 60067-6976
PHONE: +1.847.359.2790
US WEB: www.lumex.com
TW WEB: www.lumex.com.tw

DRAWN BY:	CHECKED BY:	APPROVED BY:	DATE: 1.18.01
TM/BC			PAGE: 1 OF 1
			SCALE: N/A