
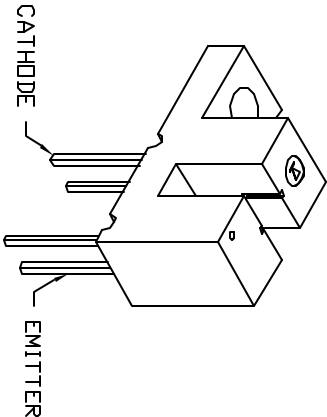
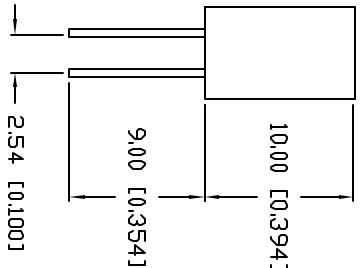
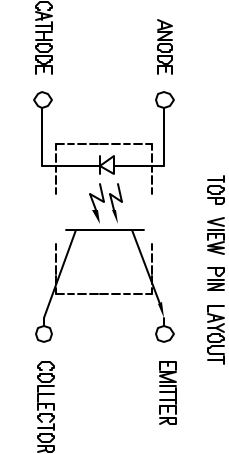
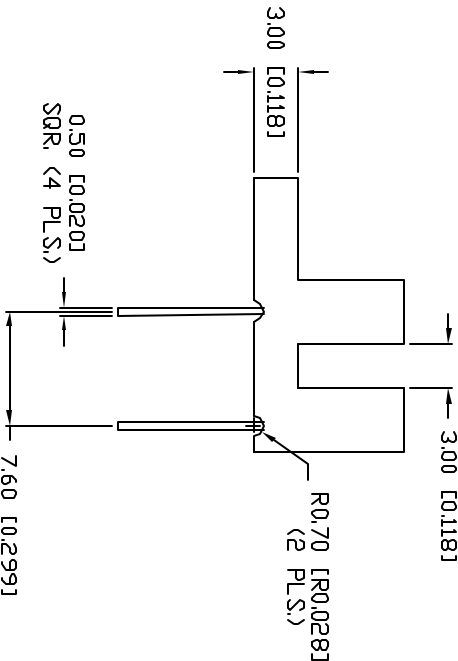


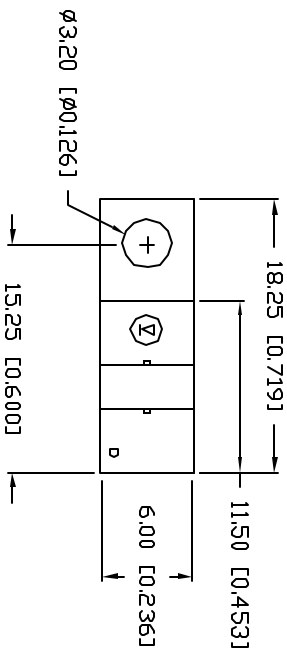

PART NUMBER			REV.
OED-S13076-1T			A
REV.	E.C.N. NUMBER AND REVISION COMMENTS	DATE	
A	E.C.N. #10BRDR. & REDRAWN IN 3D.	5.13.03	

ELECTRO-OPTICAL CHARACTERISTICS $I_A=25\text{V}$ $I_F=20\text{mA}$				
PARAMETER	MIN	TYP	MAX	TEST COND
PEAK WAVELENGTH		940		
FORWARD VOLTAGE		1.2	1.5	$I_F=30\text{mA}$
REVERSE VOLTAGE	5.0			$I_C=10\text{A}$
DARK CURRENT			100	$V_{CE}=10\text{V}$
C/E SATURATION VOLTAGE			0.4	$I_C=0.5\text{mA}$
COLLECTOR ON CURRENT	2			$V_{CE}=5\text{V}$
SWITCHING TIME		5		$I_C=100\text{A}$

LIMITS OF SAFE OPERATION AT 25°C		
PARAMETER	MAX	UNITS
PEAK FORWARD CURRENT	60	mA
REVERSE VOLTAGE	6	V
C/E BREAKDOWN VOLTAGE	30	V
E/C BREAKDOWN VOLTAGE	3	V
POWER DISSIPATION	75	mW
OPERATING TEMP.	-20 TO +80	°C
STORAGE TEMP.	-25 TO +100	°C
SOLDERING TEMP.	+250	°C
2.0mm FROM BODY	5 SEC. MAX	

- NOTES:
- MADE FROM OED-S1306-2T.
CUT OFF TAB AS SHOWN.

*UNLESS OTHERWISE SPECIFIED TOLERANCES PER DECIMAL PRECISION ARE: X=±1 (+0.039), X/2=±0.5 (+0.020), X/3=±0.25 (+0.010), X/4=±0.127 (+0.005), LEAD SIZE=±0.08 (+0.002), LEAD LENGTH=±0.75 (+0.030), MIN= -0.00

PART NUMBER

OED-S13076-1T

REV. A

PHOTO INTERRUPTER, 1 TAB.

RELIABILITY NOTE
OUR MANY YEARS OF EXPERIENCE DATA ACCUMULATION INDICATE THAT SOLDER HEAT IS A MAJOR CAUSE OF EARLY AND FUTURE FAILURE. PLEASE PAY ATTENTION TO YOUR SOLDERING PROCESS.



290 E. HELEN ROAD
PALATINE, IL 60067-6976
PHONE: +1.847.359.2790
US WEB: www.lumex.com
TW WEB: www.lumex.com.tw

DRAWN BY:	CHECKED BY:	APPROVED BY:	DATE:
BC			1.5.98
			PAGE: 1 OF 1
			SCALE: N/A